

E-band Power Amplifier

WR-12/60-90GHz/30dB Gain/26dBm Psat

Model: TMPA-060090-3026-12

TMPA-060090-3026-12 is a E-band power amplifier with a typical small signal gain of 30 dB and a nominal Psat of 26 dBm across the frequency range of 60 to 90 GHz. The DC power requirement for the amplifier is +20 VDC/1.2 A. The input and output port configuration offers an inline structure with WR-12 waveguides and UG-387/U-M anticocking flanges.

Features:

- Frequency range: 60-90GHz
- Gain: 30dB Typ
- Output Power Psat: 26dBm Typ
- Good Power and Gain Flatness

Applications:

- Passive Imaging
- Communication Systems
- Radar Systems

Electrical Characteristics:

Parameter	Min	Typ	Max	Units
Frequency range	60		90	GHz
Small Signal Gain		30		dB
Output Psat	25	26		dBm
Input VSWR		2		:1
Output VSWR		2		:1
DC Voltage		20		V DC
DC Supply Current		1.2		A

Mechanical Specifications:


Parameter	Value	Units
Input /Output Connector	WR-12/UG-387/U	
DC Bias	Solder Pin	
Size	60*60*22	mm

Absolute Maximum Ratings:

Parameter	Value
Supply Bias Voltage	+22 V
RF Input Power	+5 dBm
ESD sensitivity (HBm)	Class 0, passed 150V

Outline Drawing:

Unit:mm; Tolerance:±0.1mm

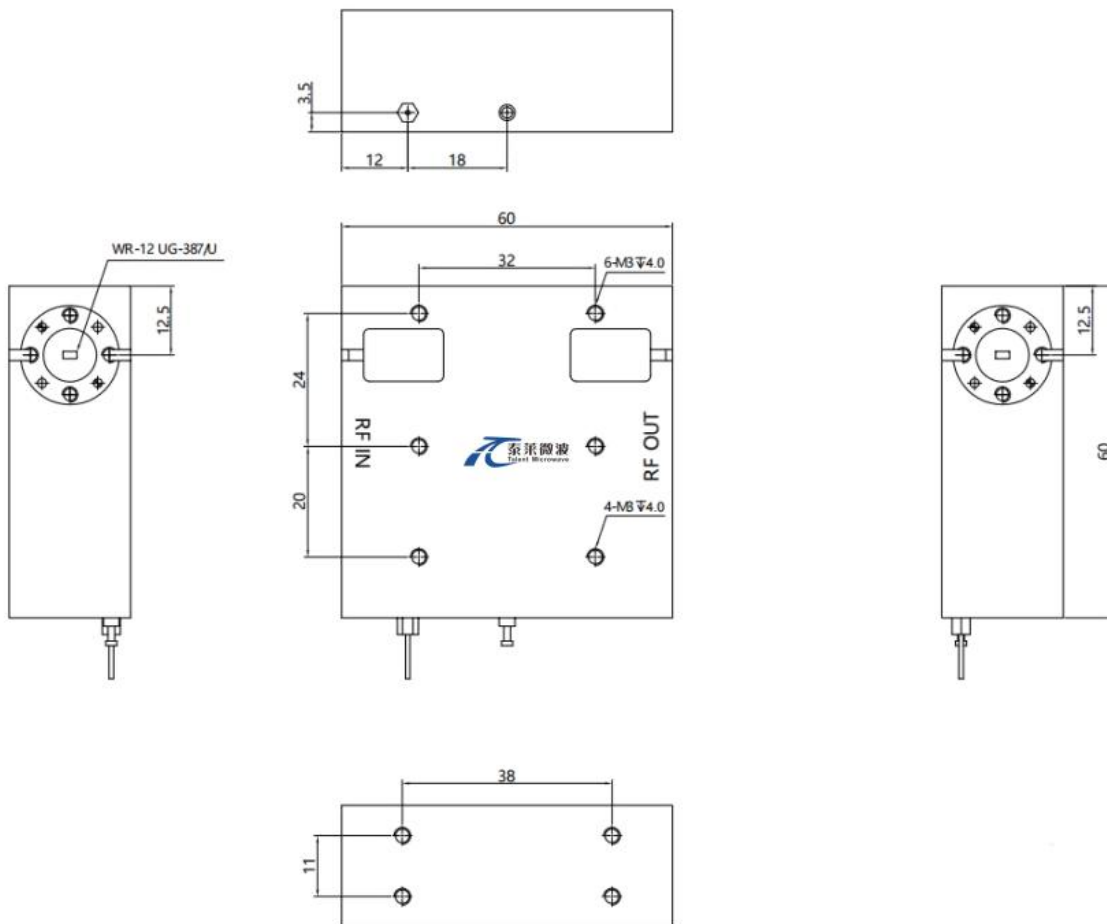

*****Heat Sink Required During Operation**



ESD Protection: Strictly adhere to ESD precautions to prevent electrostatic damage.


Environmental Conditions:

Parameter	Min	Typ	Max	Units
Operating Temperature	-10		+65	°C
Non-operating Temperature	-45		+85	°C
Relative humidity		95		%
Altitude	10,000			feet
Shock / Vibration(MIL-STD-810F)	25g rms (15 degree 2KHz) endurance, 1 hour per axis			
Shock(non operating)	20G for 11msc half sin wave,3 axis both directions			

Ordering Information:

Base Number	Description	Revision
TMPA-060090-3026-12	Power Amplifier, 60-90GHz, Gain: 30dB Type, Psat: 26dBm Type, +20V DC, WR-12, Without heatsink	Rev.1.1
TMPA-060090-3026-12-HS	Power Amplifier, 60-90GHz, Gain: 30dB Type, Psat: 26dBm Type, +20V DC, WR-12, With heatsink	Rev.1.1

Typical Performance Data:

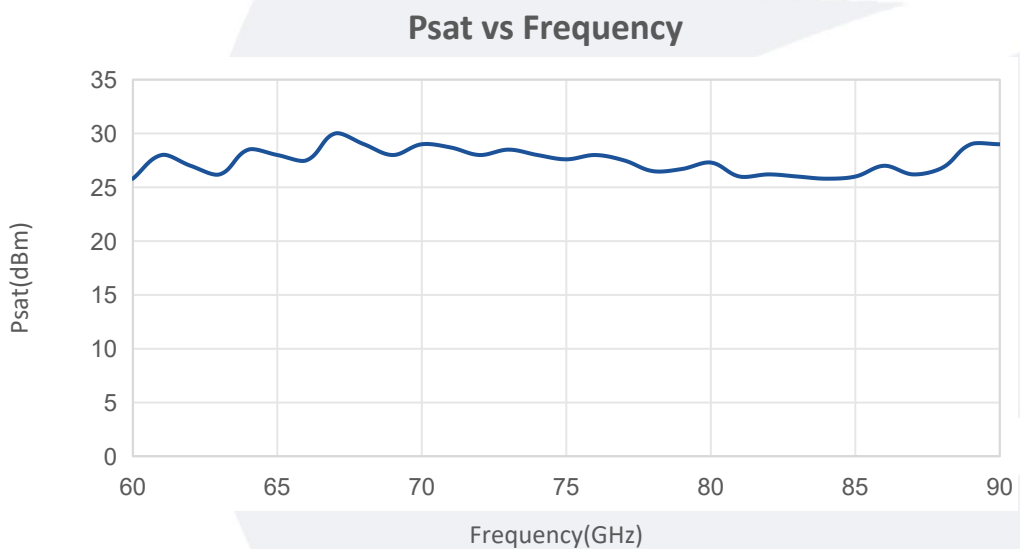

Note: Above data is for ref only, actual data may vary from unit to unit depending on operating environment and other factors like material lots etc.